

MEDINA, OHIO

STEAM TRACTOR EXPLOSION
WITH FATALITIES AND MULTIPLE
INJURIES, MAIMING

WRECKED CAB. OWNER
STOOD HERE WHEN HE
WAS KILLED BY THE
BLAST






TEST SECTION HAS
BEEN REMOVED
FROM CROWN
SHEET

WRECKED BOILER
PLATE OF
TRACTOR 080201



RECORDED
UT
THICKNESS

105

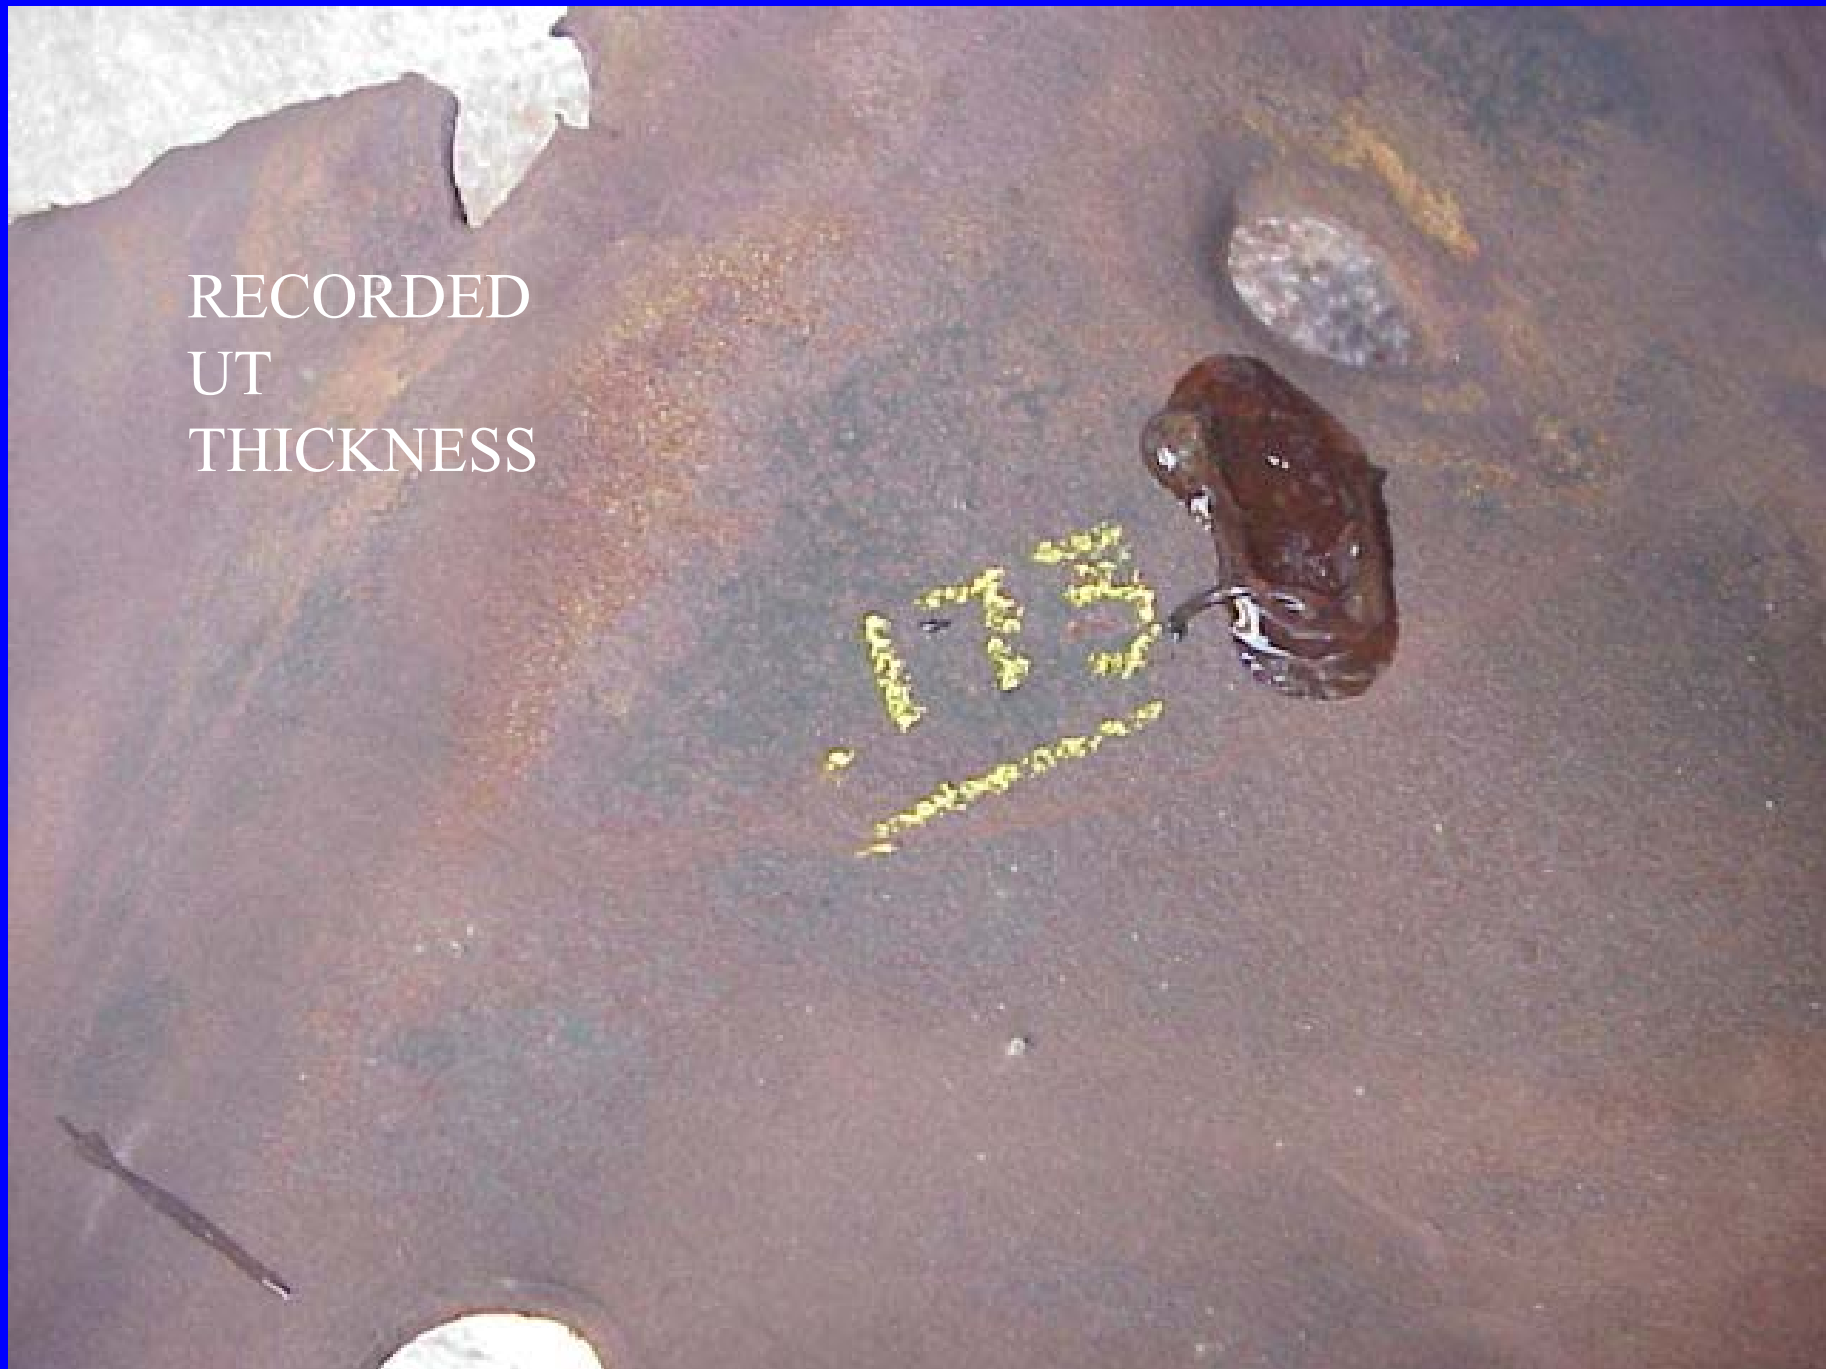


























FROM INSIDE
FURNACE



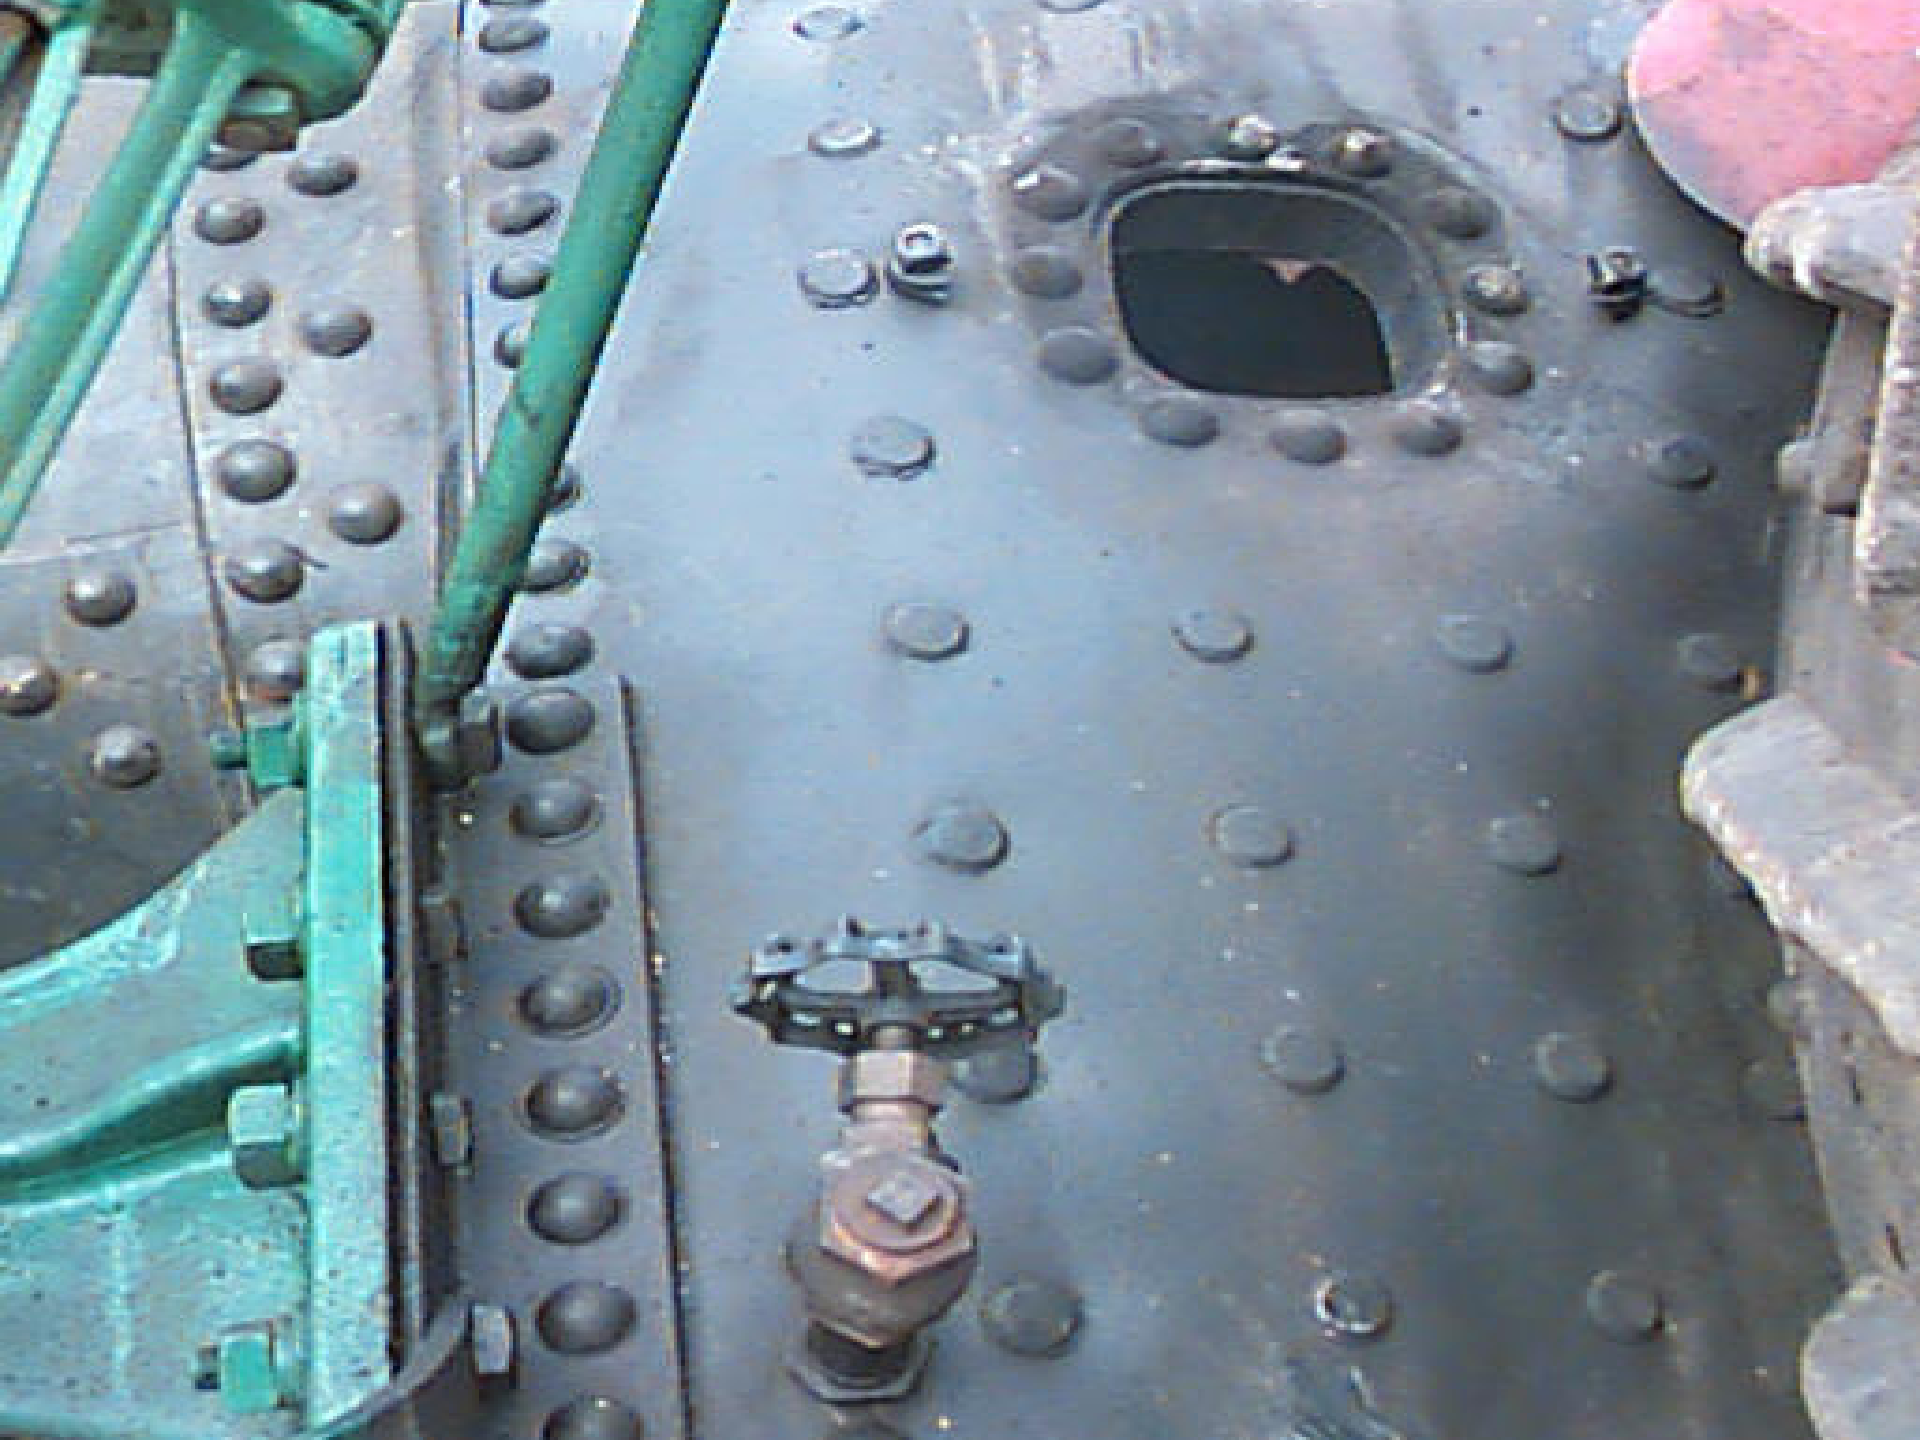

A close-up photograph of a metal structure, likely a ship's hull or a large industrial component. The surface is heavily corroded and shows significant damage. A prominent feature is a "TORN RIVETED COURSE," where a row of rivets has failed, causing a jagged, vertical tear in the metal. The rivets themselves are visible as dark, rounded protrusions. The surrounding metal is a mottled, rusted brown color. The text "TORN RIVETED COURSE" is overlaid in white, serif font in the upper right quadrant of the image.

TORN RIVETED
COURSE



SIDE SHEET RIPPED
LOOSE INSIDE
FURNACE



TORN TUBE LIGAMENTS



TORN
WRAPPER
SHEET INSIDE
FURNACE



David L. Maki:
TUBE SHEET:
NOTE THAT
CROWN SHEET
IS MISSING

